

# Installation Instructions

## for Set # 3.3191

### 63-82 Corvette

# ENERGY





# SUSPENSION

1131 VIA CALLEJON, SAN CLEMENTE, CA 92673

**Note:** It is recommended that if you are unfamiliar with this type of work that you refer to a qualified service center specializing in this type of work. It is also recommended that if you choose to do this work yourself that a factory service manual be obtained for the proper procedures pertaining to removal, replacement and proper torque specifications for your vehicle. This instruction sheet is intended as a guideline for the safe installation of Energy Suspension's polyurethane bushings, once you have removed the factory components from your vehicle.

1. Using an 11/16" bit, drill out flared end of inner metal retainer.
  2. Remove retaining washer and tap out inner retainer sleeve, inner metal shell and old rubber bushing.
- Note: Do not remove outer metal shell that is pressed into the trailing arm. See Fig. 1 This outer metal shell must be reused!**
3. Clean inside of inner metal shell of any old rubber or rust. When installing polyurethane bushings, apply grease as instructed: Apply light coat of grease to I.D. of the metal shell. Apply light coat of grease to the I.D. and O.D. of bushings (all surfaces that contact metal). Apply light coat of grease to the O.D. of sleeve. Apply light coat of grease to the faces of the bushings before the cap washers are installed.
  4. Refer to (Fig. 2) for assembly of your new polyurethane bushings.
  5. After applying grease to all necessary parts, use a press or vice (Fig. 3) to install the cap washers into the inner sleeve. The cap washers are not a press fit, the excess grease will help hold the cap washers in place. Be sure to have the cap washers square with the new inner sleeve when assembling together (Fig. 4).
  6. Reassemble your trailing arm and install back into your vehicle according to the factory service manual. When finished, Energy Suspension recommends a four wheel alignment at a qualified service center.

(If your original outer metal shell is unuseable, get new replacements from GM, P/N 3743857).

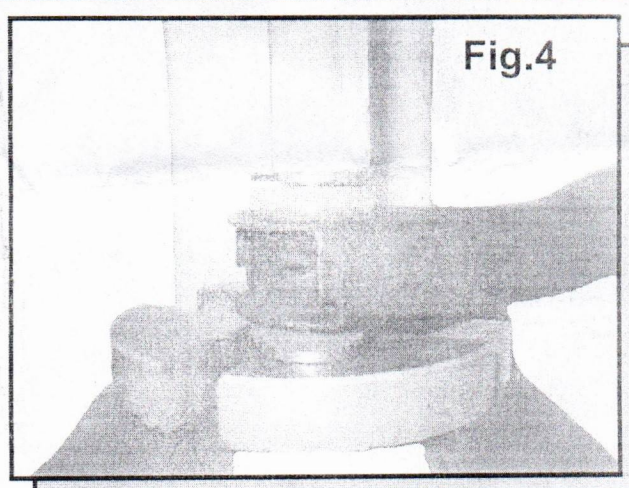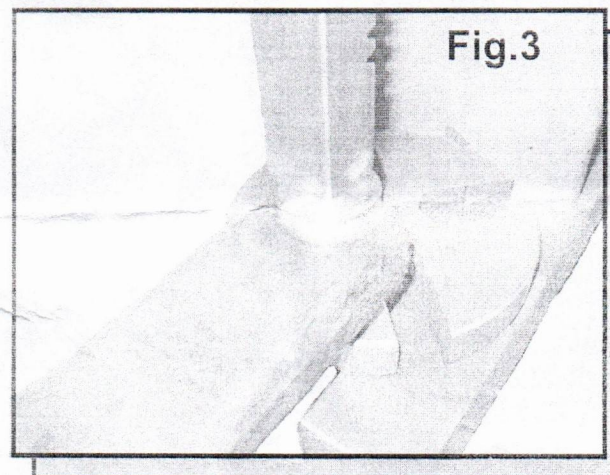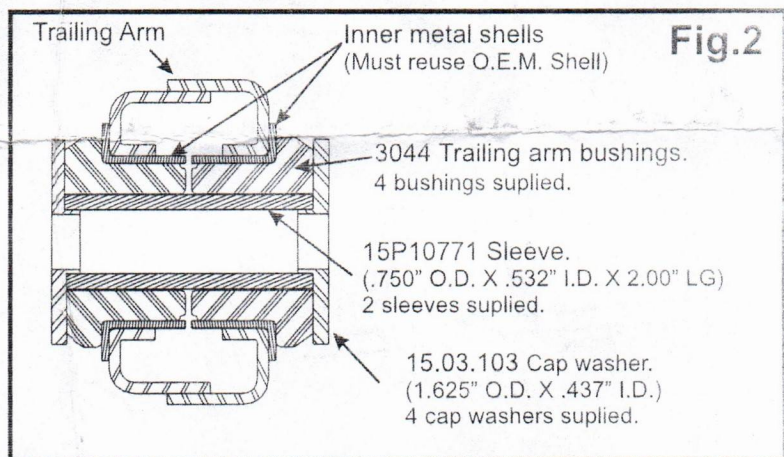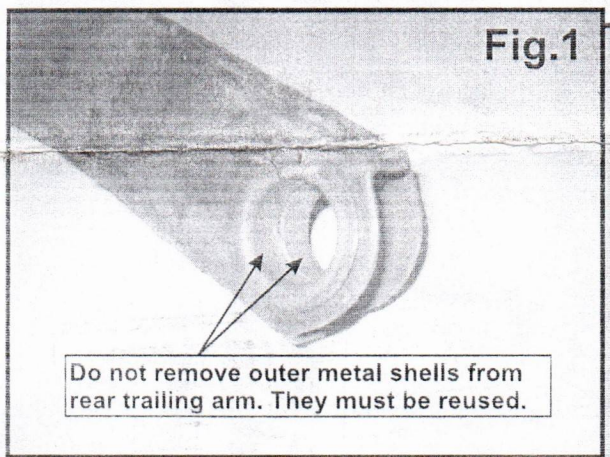

© 2005 Energy Suspension. All rights reserved.  
May not be reproduced, in any form, or by any means,  
without the written consent of Energy Suspension.

17366

15/SEP/22 BRH ECN 22080